

C019 Film Scanning Unit: Pick up setting

Firstly check that the pick-ups are not marked as 'RS', if so the first step would be to replace the roller assembly, as a faulty batch exists.

The sensitivity of the pick-ups is controlled by two potentiometers, situated within the C019 electronics box (the box with the 'Pulse' and 'Film Ok' LED's).

Initially use a piece of white card placed over the rollers, this will initially be detected by the pick-ups. Adjust the potentiometers until the white card is no longer detected.

Substitute the white card for a strip of silver foil, adjust potentiometers until the silver foil can be detected.

